




Asbestos fuse cylinder found during assessments

WHAT HAPPENED?

During an asbestos assessment one of the assessors inspected an out-of-service fuse carrier and fuse. The fuse cylinder was made of Chrysotile Asbestos.

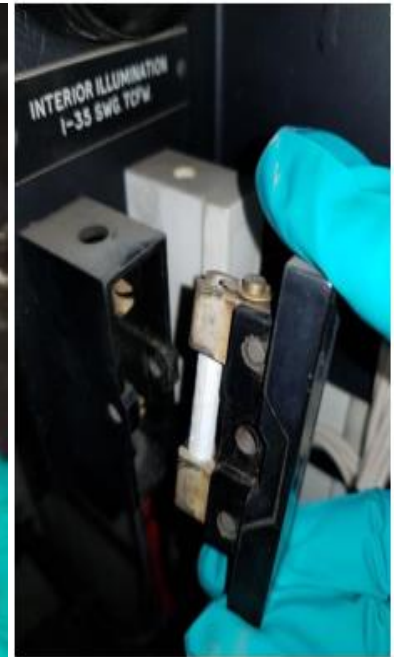

IMMEDIATE ACTION TAKEN

- A sample was taken and a label applied.
- The enclosure was closed off and the personnel were informed.
- The Service Provider was informed.

ROOT CAUSE

Historic use of asbestos is common in our network. As long as we do not disturb asbestos containing material (ACM) there is no potential for exposure.

LEARNINGS

- Asbestos has been used extensively in the past and we should always be vigilant when carrying out work on our assets.
- Use TP.SS.06.55 for guidance on any asbestos related issues you may encounter on site.



For more information,
please contact:

Name: Dan Quinn
Designation: Asbestos Management Advisor
Ph: 0800 TPASBESTOS
Asbestos@transpower.co.nz