

Safety Bulletin No. 03(a)/2016

CRESTO 829C & 859C FULL BODY HARNESS

Issue date	14 March 2016
Issued by	Vincent Cranny, Head of Health, Safety & Environment
Applicable to	Employee issued with the Cresto 829C & 859C Full Body Harness


We have been alerted to a potential product defect relating to AustriAlpin COBRA® buckles which are fitted to the Cresto 829C and 859C Full Body Harness.

AustriAlpin have stated that in an extremely small quantity (0.00005% = 1 out of 2 million) of COBRA® buckles there may exist parts where the rivets have not been press fixed. This results in the rivets being loose and the release clips detach.

Before use, all personal safety equipment shall be checked for damage or deterioration. As a precaution all employees issued with either the Cresto 829C or 859C Full Body Harness are asked to pay particular attention by visually checking the harness buckles to ensure the rivets have been correctly fixed as per the pictures below.


If you notice the buckle is NOT riveted correctly stop using the harness immediately.

Correct

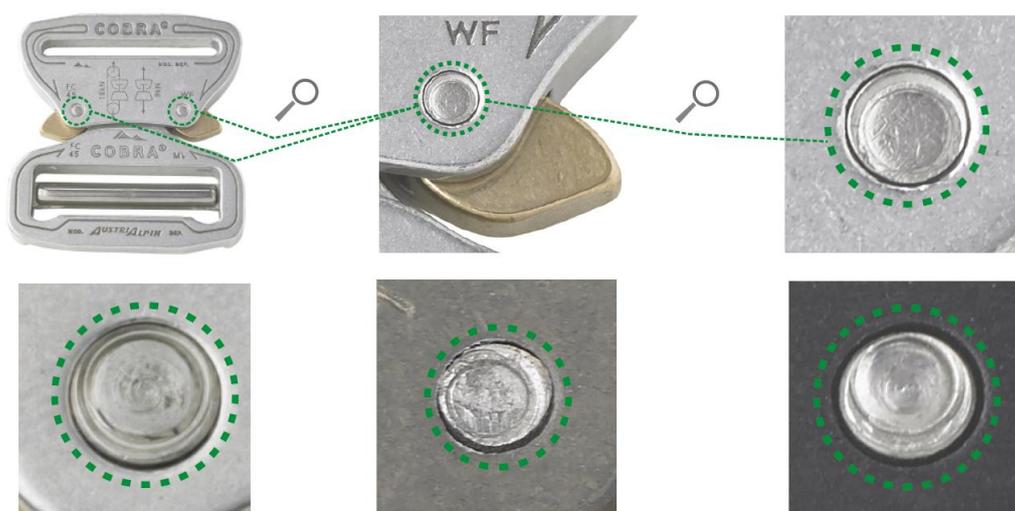

The rivet shows an embossing in the form of a ring on both the front and back sides of the rivet. Do not manipulate the rivets by mechanical action.

NOT Correct

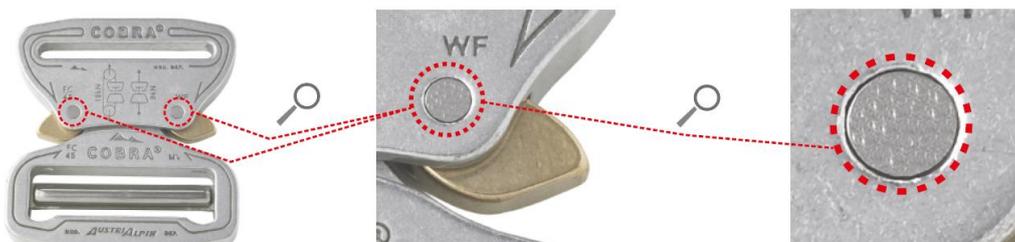

The rivet does not show any circular embossing.



Safety

