


SHE ALERT

Live 11kV Cable Cut



Date of incident which is raised in days	25/07/2024		Directorate	SEPD – Customer Service	
Region	Large Connections	Location	Brentford	Classification	PTBW
What happened ?					
<p>While in the process of installing a new substation in Brentford, West London, SSEN SAP had correctly Isolated, earthed, identified and spiked an 11kV cable under Sanction-For-Test.</p> <p>Contract partner jointer then inadvertently cut through an adjacent LIVE 11kV cable using a reciprocating saw, this caused a flashover to occur and the 11kV circuit to trip.</p> <p>All correct PPE for the task being worn and No injuries received.</p> <p>Prior to cutting ANY cables, ensure they are identified by an approved procedure and all other live cables are screened.</p> <p>This is under a full investigations and the learning points will be issued as part of the follow-up Brief.</p>					

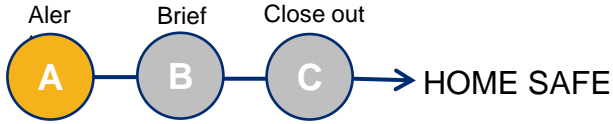