



Event Number: 157732

Event Date: 8/03/2025

Event Classification: Network Near Miss


WHAT HAPPENED

Whilst investigating a no power a first response employee discovered a tech screw had been used to secure a pillar lid by a 3rd party, and on testing, found the screw to be live to 232v.

Full PPE was being worn at the time.

IMMEDIATE ACTIONS:

Removed the metal tech screw.

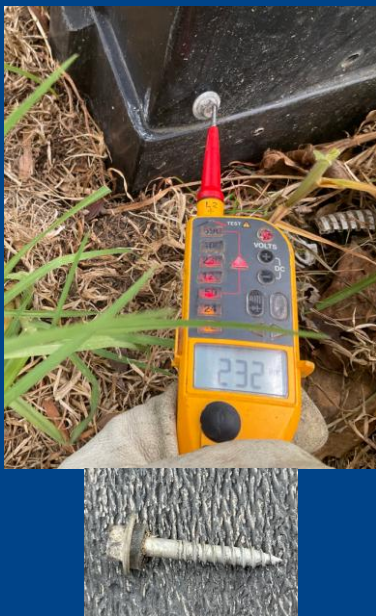

LESSONS LEARNT

Contributing Factors:

The tech screw had pieced through to a live phase and made contact.

Actions to Prevent Recurrence:

Use the correct plastic retaining screw available in stores and as pictured below.

Lessons Learnt

Test all tech screws used to hold pillar lids in place before removing them.



For further information please contact: Maarten Tinsel, HSE Manager.

Email: maarten.tinsel@omexom.co.nz

Date of release: 14/03/2025

This Safety Advisory/Bulletin is for information purposes only and it is not to be relied upon as expert or professional advice or services. You are responsible for obtaining appropriate professional advice.