



**Health, Safety & Environment Alert
Not Protectively Marked**

EFS-79

Issue: 2.0

Issued: October 2014

Review: October 2016

Ampy Meters - Cracked Covers


Following recent visits to customer premises it has been discovered the front plastic covers, which enclose the main body of the meter, had become brittle. If disturbed these covers may break with the risk of exposing live terminals.

The meters concerned are:

Manufacturer: **Ampy**
Type: **5196 A/D**
Manufacturer date: **2000**

If you should encounter this type of meter, approach with caution and do not touch before de-energising.

[Below are photographs of meters discovered.](#)

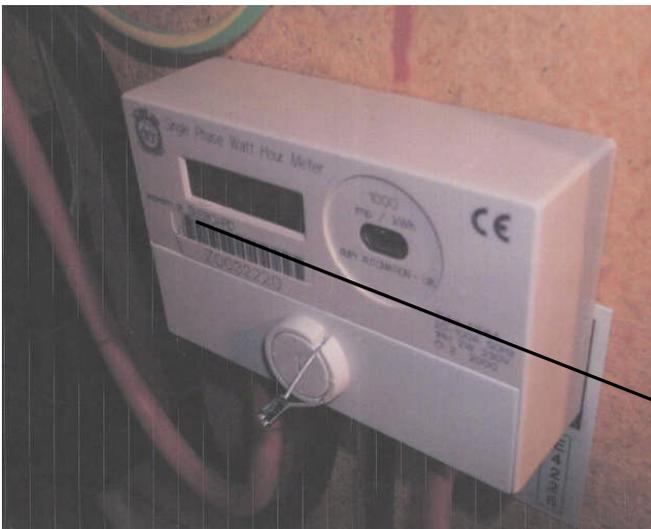

Hairline cracks on the cover during inspection

It is the responsibility of line management to ensure that all appropriate employees are briefed about this Alert and that their understanding of the contents is checked. This Alert will be subject to Compliance audits after 14 days from the date of issue.




**Health, Safety & Environment Alert
Not Protectively Marked**

EFS-79

Issue: 2.0

Issued: October 2014

Review: October 2016

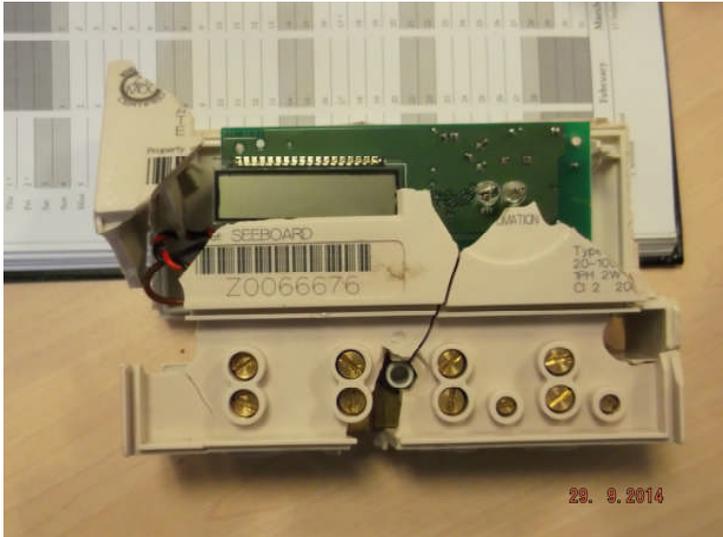

On removal, the meters are extremely fragile and the covers can break



The cause has yet to be determined but the manufacturers have been notified.

It is the responsibility of line management to ensure that all appropriate employees are briefed about this Alert and that their understanding of the contents is checked. This Alert will be subject to Compliance audits after 14 days from the date of issue.