

# Safety Bulletin

## Harness, Climbing and Lifting Equipment Recall

### Summary

There are several recalls from manufactures of; harness, climbing and lifting equipment that under certain conditions, could expose workers to serious injury or death. The manufactures are signalling immediate action to be taken for the following:



### 3M™ PROTECTA® Cobra Rope Grab AC202D

Cobra Mobile/Manual Rope Grab AC202D is incorrectly stamped for use with 1/2 to 3/4 inch diameter rope on the exterior body of the unit.

[Link to Notice](#)



### 3M™ DBI-SALA® Nano-Lok™ edge and Wrap Back Twin-Leg Self Retracting Lifelines

Immediate stop use and product recall of the 3M™ DBI-SALA® Nano-Lok™ edge and Wrap Back Twin-Leg Self Retracting Lifelines.

[Link to Notice](#)




Step 1 Manufacturer Date on Harness Shown in Red Circle – must be between 16/01 (2016, January) and 18/12 (2018, December)



Step 2 Lot Code Stamp Location on D-ring – lot code must be (09P1)

### 3M™ DBI-SALA® ExoFit NEX™ Harnesses with lot # 09P1

Possibility of a manufacturing defect in a dorsal d-ring utilized in ExoFit NEX™ harnesses manufactured between January 2016 and December 2018. [Link to Notice](#)

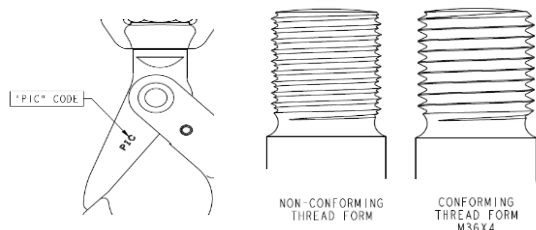

### Crosby - S-1326 18/20 mm Shur-Loc Hook with 16t WLL, PN 1004349 With Production Identification Codes (PIC) of 9SB, 9SC, and 9SD as located on the latch

Crosby has determined the above listed hook assemblies may have non-conforming thread forms that can reduce the ultimate load capacity.

[Link to Notice](#)

### Actions you need to take

You shall review the equipment stated here and determine which is used by your teams  
As appropriate you shall refer to the full recall information provided in the [Links to Notice](#) above  
You shall ensure all necessary actions are taken